



# ROCKINGHAM COUNTY CONSERVATION DISTRICT

110 North Road, Brentwood, NH 03833-6614  
Tel: 603-679-2790 • Fax: 603-679-2860  
www.rockinghamccd.org

18 December 2013

Eric Fiegenbaum, Administrative Assistant  
Town of Madbury  
13 Town Hall Road  
Madbury, NH 03820

RE: Frank Catapano  
38 Huckins Road  
Tax map/lot: 2/20  
RCCD #MA2-20-L13

Dear Mr. Fiegenbaum;

On this date I witnessed 5 additional test pits for a proposed residential subdivision. The designer representing the owner was Jim Gove of Gove Environmental Services.

The following features were observed:

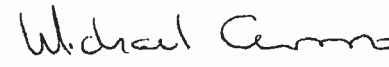
Test Pit	Seasonal High Water Table	Bedrock	Total Depth	Pass/Fail
A1	18"	no	48"	fail
A2	25"	no	68"	pass
A3	17"	no	60"	fail
A4	16"	no	64"	fail
A5	24"	no	63"	pass

**Test pits A2 and A5 meet town and state soil requirements for wastewater disposal.** Whether the test pits meet setback requirements and the acceptability of the 4,000 square foot reserve area can be determined after the test pits are survey located and presented on the subdivision plan.

The remaining test pits (A1, A3, and A4) do not meet the locally required minimum 24 inches to seasonal high water table.

A test pit field summary is attached.

Sincerely,

  
Michael Cuomo  
NH Certified Soil Scientist #6  
NH Certified Wetland Scientist #4  
NH Designer #788

  
Cynthia W. Smith  
Chairman, Board of Directors